




S86

STP

2010-06-18





敏锐

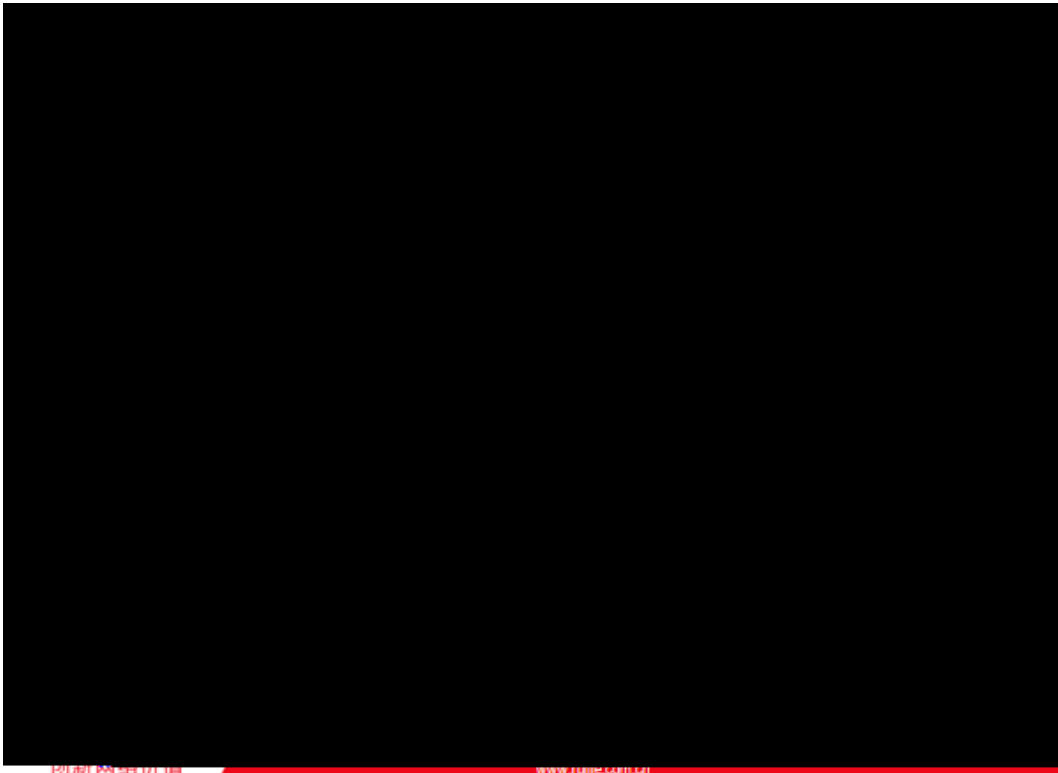

敏锐网络科技

www.rujie.com.cn



1. C3750 C2950 H3C3600 PVST+ C6509 C4507
HSRP PVST+ VTP SNMP
OSPF
2. GDHG NLB
- NLB
- 3



1 MSTP

```

S8610 Catalyst 4507
MSTP S8610 10.3 5 Catalyst 4507
12.2(31)
Catalyst 3700 S8610 Catalyst 4507

1
Catalyst 3700 S8610 4507
8610

2
Catalyst 3700 S8610 3700
4507 3700 8610
3700 8610
3700 4507

37 29 IOS 10.1 10.2

```

2 S8600 H3C 3600 BPDU

```

S8610 H3C 3600 BPDU

H3C 3600 S8610 DISC

H3C 3600 LOG BPDU LOG
%May 20 21:16:01:118 2010 Hostname_H3C3600
MSTP/3/BPDUFORMATCONFIGERROR:- 1 -Port GigabitEthernet1/1/3 received different

```



1.

1)MSTP

2)S8600 H3C 3600 BPDU

MSTP	domain name	revision	instance
	IST 0		2950

CISCO STP	CISCO
STP MSTP	
H3C3600 STP	


4.	log	5.	show	6.	7.
----	-----	----	------	----	----

2.

12.1(22)EA13 MSTP

2950 IOS







C2950 BLOCK 802.1s 20002 IEEE Standards for Local and
BPDU metropolitan area networks Virtual Bridged Local Area Networks—Amendment 3:
Multiple Spanning Trees

H3C3600

